

NASA Project Management Conference University Park Maryland March 30-31, 2004

The Challenge of Safe Return of the Space Shuttle to Flight

N. Wayne Hale, Jr.
Space Shuttle Program
Deputy Manager



Program Management Challenges to the Safe Return of the Space Shuttle to Flight



- Columbia Accident
- Complexity of the Problem
- Technical Challenges
- Cultural and Organizational Challenges
- Classical Project Management Tradeoffs
- Conclusion




Program Management



Classic Program Management has 3 components Cost, Schedule, and Content

- This is an usual project management time for the Shuttle Program
- Cost is a significant concern
 - Operations have ceased and all operating funds and personnel are available for Return to Flight work
- Schedule is not a driver
 - Desirable to fly as soon as practical to support the International Space Station (ISS)
 - Schedule is set from technical milestones
- Content is the only significant management concern
 - How safe is safe enough?
 - When have we done enough?
 - How can we prove it?

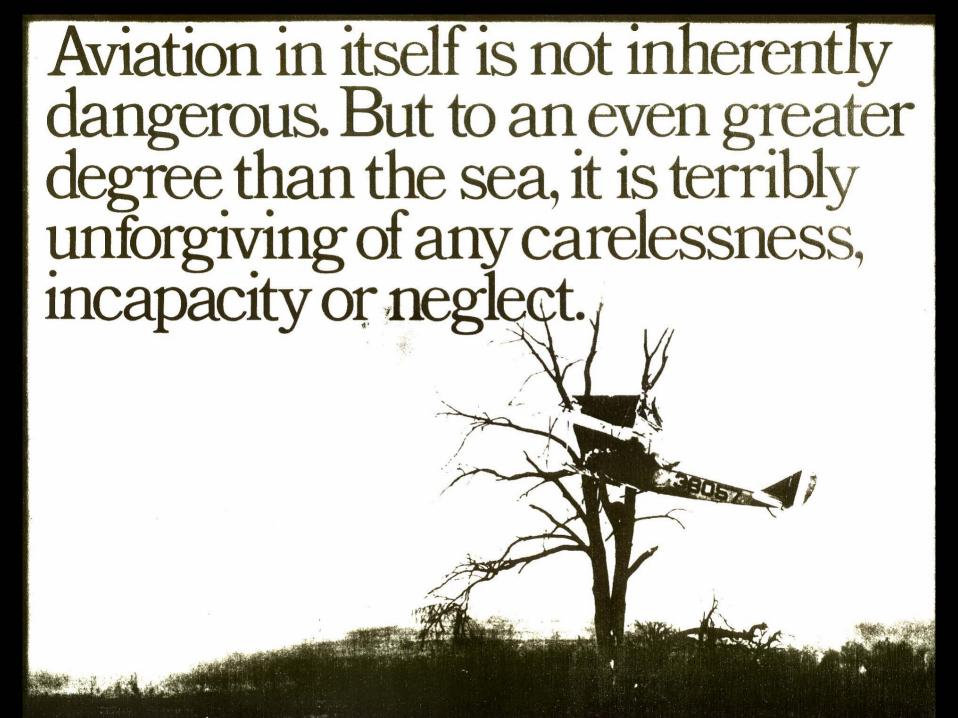




CAIB Accident Scenario



- Post-launch photographic analysis determined that External Tank left bipod foam impacted Columbia's left wing
- The foam impacted in the vicinity of RCC panels 5 thru 9 at 81.9 seconds after launch
- The orbiter was at an altitude of 65,860 feet traveling at Mach 2.46 at time of impact

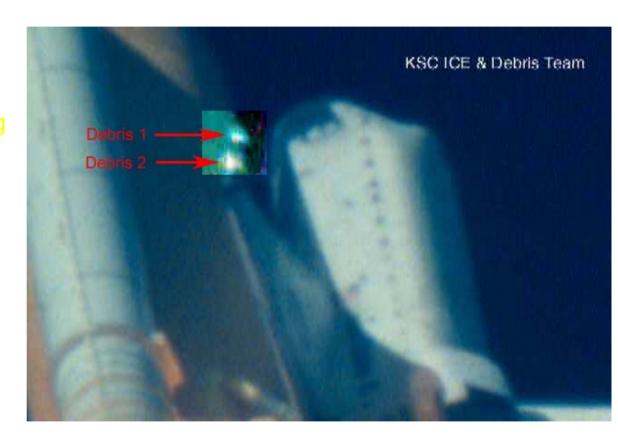





CAIB Accident Scenario




- The best estimate of the foam size, based on imagery measurements, was 21 to 27 inches long and 12 to 18 inches wide
- There was sufficient visual and debris trajectory information to implicate the left bipod ramp area as the source of debris

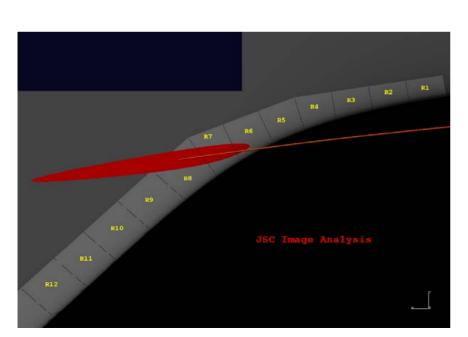

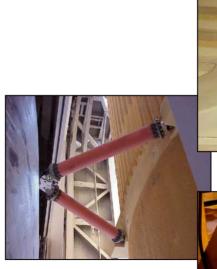



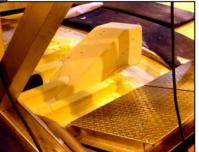





CAIB Accident Scenario



• Eventually the vehicle motion was too great for the flight control system to manage, leading to loss of vehicle control and aerodynamic break-up

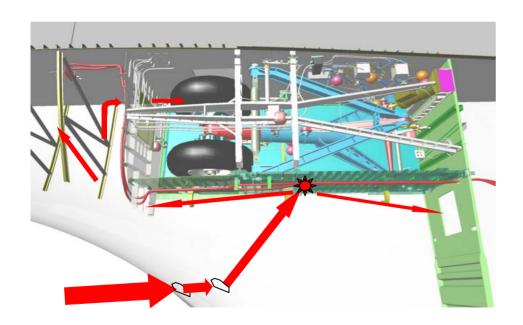

Hot gas breaches the wheel well

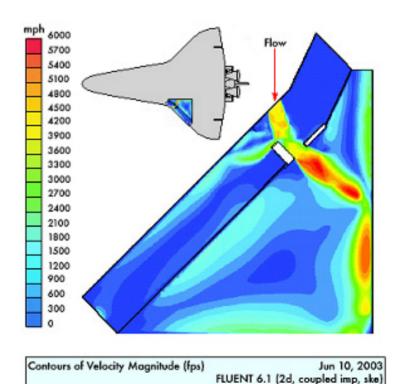




RCC Impact Testing June – July 2003 Confirms Accident Scenario





 Initial foam impact test on RCC Panel # 6 results in a panel rib crack

- Five (5) Fiberglass panel tests were conducted to provide additional model output information
- RCC Panel # 8 was tested on July 7, 2003; the 1.67 pound piece of foam impacted at approximately 775 ft/sec; resulting in a 16 inch diameter hole

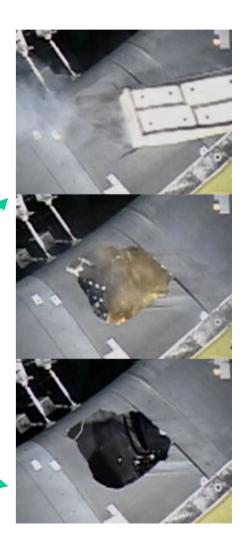





Columbia Board Recommendations Critical Path Drivers



29 Recommendations in the Following Categories:

- Improve Thermal Protection System Monitoring and Repair
- Fix Debris Shedding from the External Tank
- Improve Vehicle Imaging Capability
- Qualify the Bolt Catcher Separation Mechanism
- Improve Flight Hardware Closeout Documentation
- Improve the Foreign Object Debris Program
- Improve MMT Training
- Launch Schedules Consistent with Resources
- Upgrade Orbiter Sensor Data
- Create an Independent Technical Engineering Authority
- Upgrade Closeout Photo Process
- Improve Wire Inspection
 Techniques
- Re-Certify the Shuttle for Flights beyond 2010

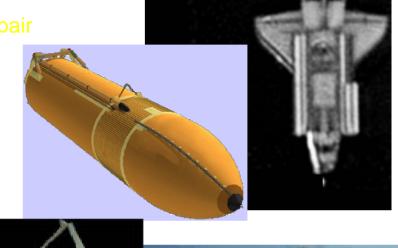


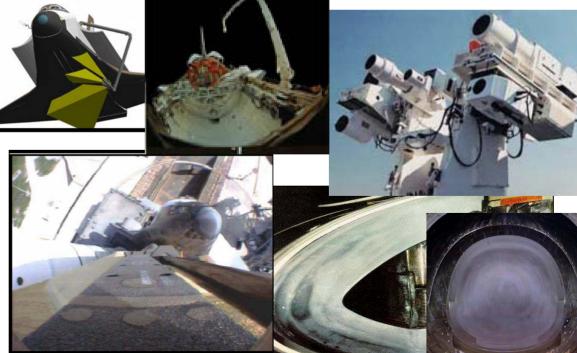



External Tank



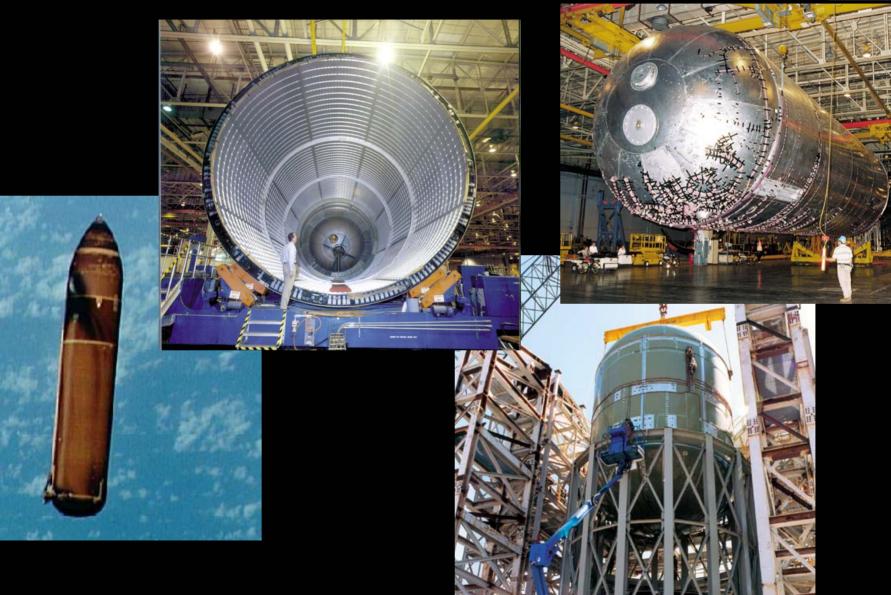



Return To Flight (Rtf) Planning

External Tank Certification




- Forward Bipod Ramps
 - Spray on Foam eliminated
- Liquid Oxygen (LO2) Modified
- Nondestructive testing











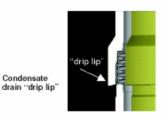

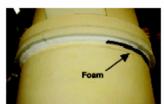

Condensate drain "drip lip"

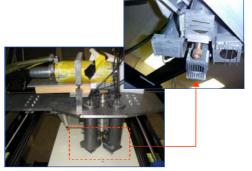

Condensate








ET Return to Flight Baseline



As-Built Critical TPS Application Certification Plan



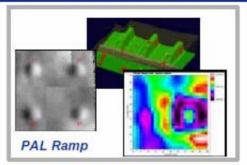

TPS NDE Development

Redesigned Bipod Fitting





LO2 Feedline Bellows Ice

LH2 | Intertank Flange Closeout Debris Elimination





ET Camera (Enhanced In-flight Imagery)





RTF Planning External Tank Certification




Nondestructive Evaluation (NDE) testing adds confidence to critical


debris elimination plan

 Protuberance Airload (PAL) Ramp foam certified by NDE testing




 Critical debris size and transport mechanism studies continue on the critical path for return to flight

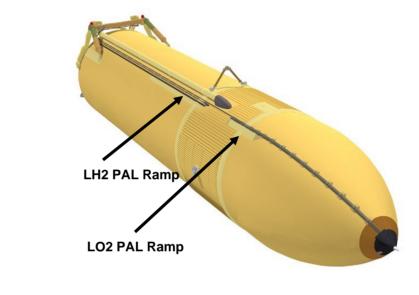

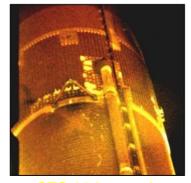

STS-26 Intertank Flange Foam Loss




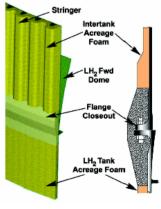



Debris Impact Environment Process



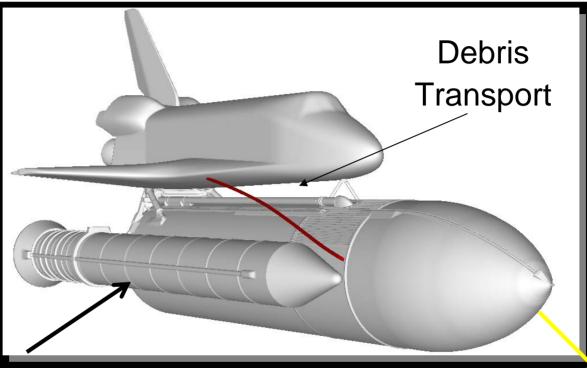

Debris Source






Damage Assessment



Debris Impact Environment



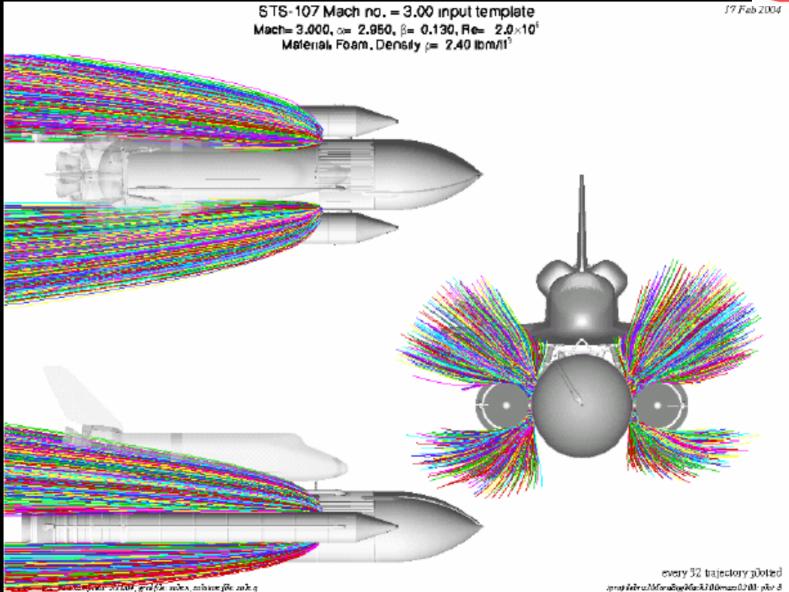



Liquid Hydrogen Intertank Flange


Critical Debris Zone



 Critical debris zone previously identified as +/-67.5° from Z axis, Orbiter side of tank

Feedline Fairing (reference)



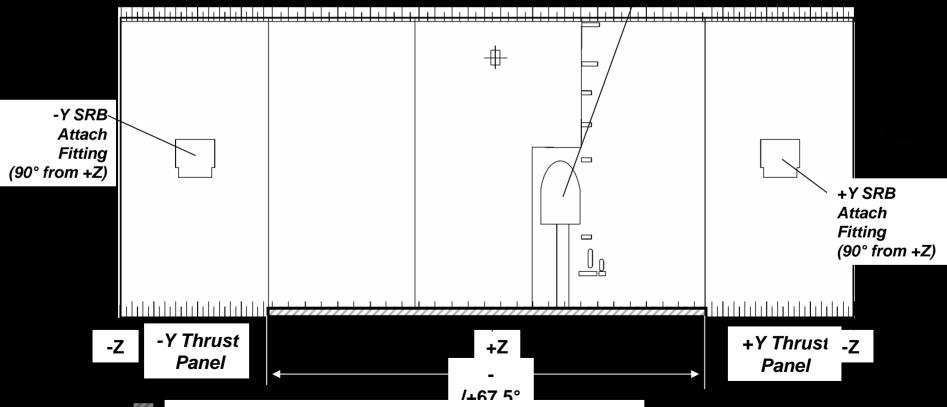



+Z Stringer Panel, Area originally identified for removal/ replacement with enhanced closeout



Impact of Extended

Critical Debris Zone



- ET currently removing the Intertank/LH2 tank flange closeout in the specified zone – Skin/stringer substrate configuration
 - Replacing closeout with enhanced, verified and validated process
- Removal of additional closeout required due to increase in zone
 - Different substrate configuration (machined ribs) in extended zone


-Y SRB Fitting

Critical Debris
Zone(s)

67/5° from +Z

80.0° from +Z

>80.0° from +Z

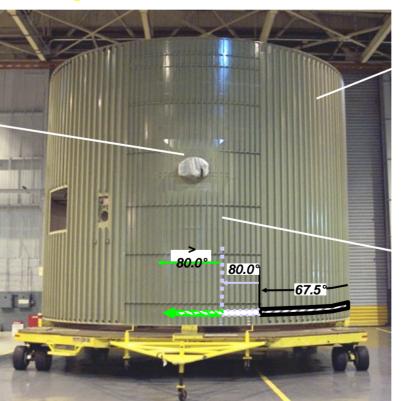

Intertank Substrate Configuration

Skin/Stringer Panel
(Lower flange area
originally identified for
removal/ replacement with
enhanced closeout)

Thrust Panel
Additional lower flange
closeout removal required
due to extended critical debris



RTF Planning Improved Ascent Imagery




- Detection on ascent improved by using integrated approach
- Additional Ground-Based trackers added and all upgraded
- Aircraft and ship-based support under consideration
- Digital cameras on External Tank, Solid Rocket Booster, and Orbiter improve realtime assessment
- Handheld crew cameras support added systems



Proposed STS-114

Camera Locations

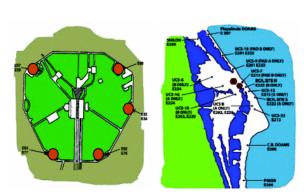

Short, Medium and Long-Range Trackers



SRB Mounted Camera



FT Mounted Camera



Ground Tracking



FY 2005 Shuttle Mission Planning



Several Factors Bear on Launch Window Determination

- Beta Angle Cut-Outs prohibit specific periods for ISS docking (thermal constraint)
- Launch and ET separation in daylight conditions
- Launch on Need (STS-300) vehicle available for call-up within 90 days
- De-conflicting from Soyuz launch windows






RTF Planning Orbiter Enhancement



- Program adding Wing Leading Edge instrumentation
- Impact Monitoring System with 92 sensors per wing

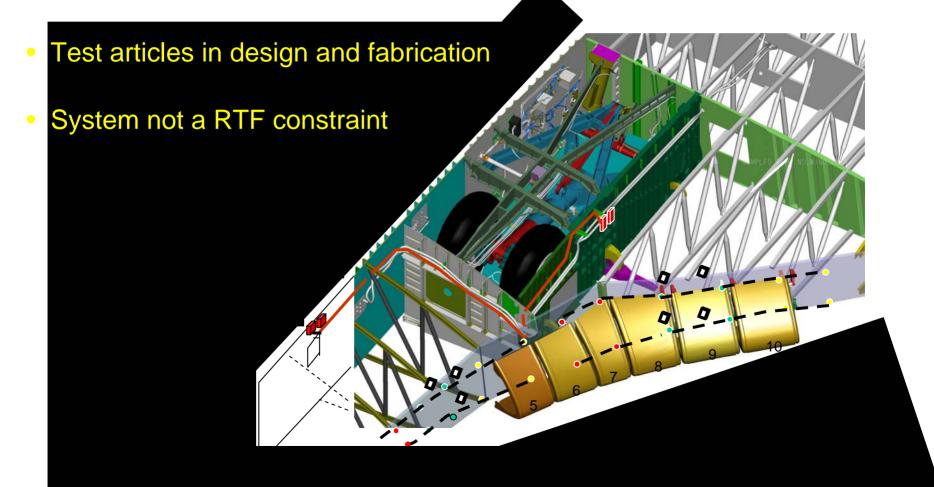





RTF Planning On-Orbit Inspection



- New boom for Shuttle system for TPS inspection
- Attaches to the existing Shuttle's robotic arm
- Boom mounted television/laser sensors
- System compliments other RTF initiatives to understand TPS condition post-launch
- Boom system currently on critical path

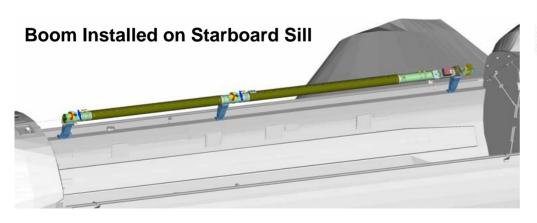



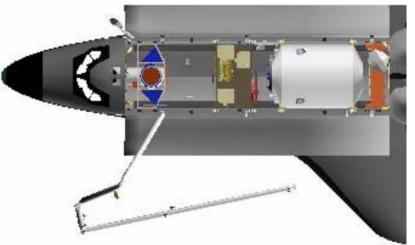





RTF Planning On-Orbit Inspection



- Various techniques being considered
- Techniques for conducting inspection at ISS under study
- ISS crew with on-board cameras may provide additional Shuttle TPS evaluation
- Evaluating use of Shuttle and Station robotic arms to facilitate 100% TPS inspection capability

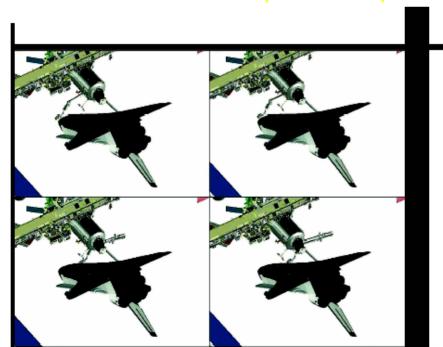

Orbiter
Pitch-Around
for Inspection
and
approach to
International
Space Station

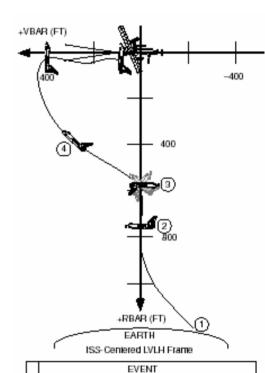

1	1000 FT RANGE RATE GATE (RDOT = -1.3 FPS) TRANSITION TO LOWZ
2	ORBITER ACQUIRES RBAR
	600 FT (RDOT = -0.1 FPS BEGIN 1 DEGISEC POSITIVE PITCHAUTO MNVR: MODE TO FREE DRIFT TO PROTECT ISS FROM ORBITER PLUME LOADS AND CONTAMINATION

SS PHOTOGRAPHIC SURVEY OPPORTUNITY FROM U.S. LAB WINDOW

RESUME ATTITUDE HOLD AS ORBITER RETURNS TO RBAR ATTITUDE AND PILOT BACK TO NOMINAL APPROACH PROFILE

4 TORVA (TWICE ORBITAL RATE RBAR TO VBAR APPROACH)





RTF Planning

On-Orbit Repair




- Various approaches being considered
- Tile repair concept well-defined; cure inplace ablator (CIPA) and application tools in development
- RCC repair tools still in conceptual phase
- First flight to demonstrate TPS repair capabilities

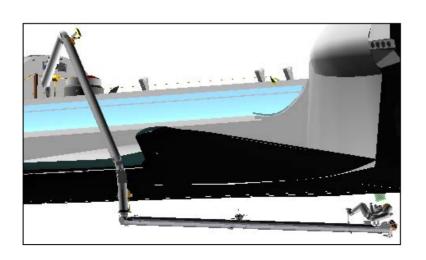

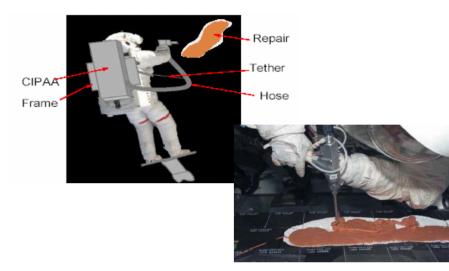

Wrap Concept

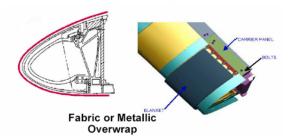



Fill Concept







Insert Inflate


Fill



RTF Planning Orbiter Processing




- Reinforced Carbon-Carbon Wing Leading Edge panels removed and inspected; Nose Caps removed and inspected
- Discovery Rudder Speed Brake actuators inspected for corrosion, grease degradation and gear alignment – has become a fleet issue
- Wire and Flex Hose Inspections conducted on both Orbiters; repairs in work
- Discovery tiles inspected for de-bonds and replaced as necessary

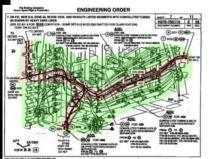



Flex Hose Inspections

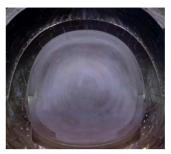





Wing Leading Edge



Rudder Speed



Tile Bond Anomaly




Orbiter Wiring Inspections



Wiring



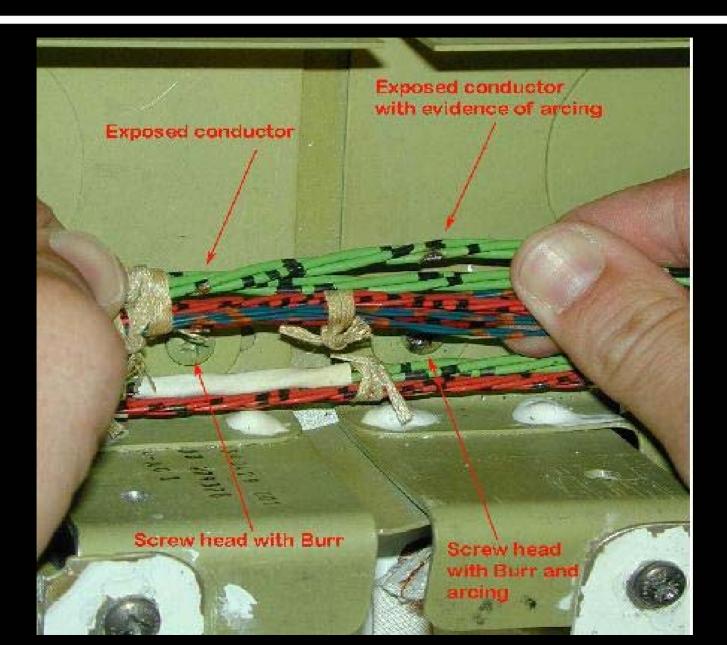




Rudder Speed Brake (RSB) Actuators



Background: During the OV-103/Discovery Orbiter Maintenance Down Period (Summer of 2003), Corrosion was found on the Orbiter's Body Flap actuators

- Since the Body Flap actuators and Rudder Speed Brake (RSB) actuators were fleet leaders (most flight time), decision was made to also remove the RSB actuators and inspect for corrosion
 - All 4 RSB actuators appeared to have corrosion and were sent to the vendor for further inspection and refurbishment as required

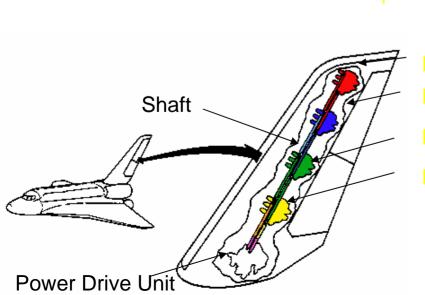

RSBA #4 RSBA #3

RSBA #2

RSBA #1





Rudder Speed Brake (RSB) Actuators



- Decision was made to install the spare RSB actuators while the other units were undergoing vendor inspection
 - Issue was raised about whether the grease in the spares had degraded and might pose a threat if re-installed – independent analysis initiated
- While the RSB actuators were undergoing vendor inspection, one of the actuators was found to have an improperly installed planetary gear

Result: The improperly installed planetary gear led to a decision to look at the RSB actuators in all three vehicles and determine if there were other planetary gears improperly aligned. This had a significant impact on being able to meet a fall 2004 launch date.









Cost




- Funding the Return to Flight work
 - Supplemental money
 - Release of unused operations budget
- In the face of a renewed engineering challenge, workforce is expanding in a permanent manner to significantly improve safety
- Next challenge will be cost containment
 - Challenge of maintaining engineering excellence in the face of a future falling budget



Strategy Based on Long-Term Affordability



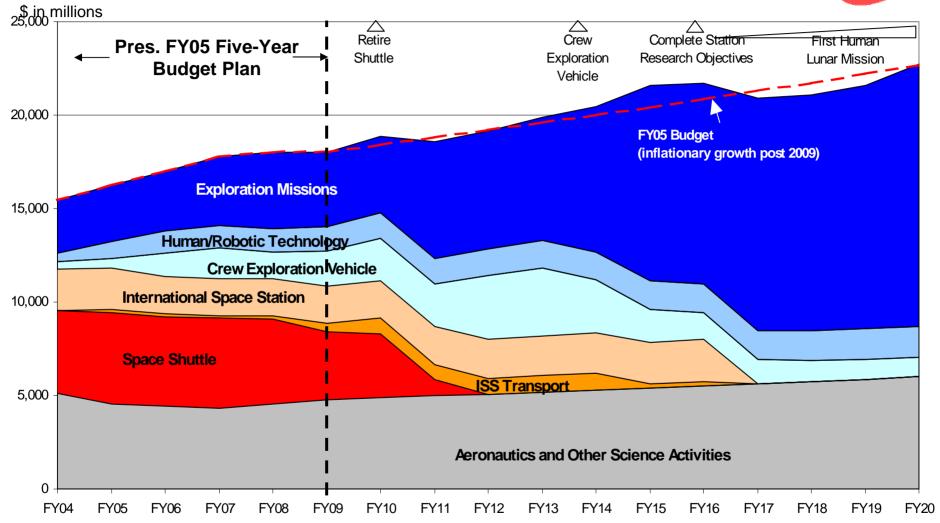

NOTE: Exploration missions – Robotic and eventual human missions to Moon, Mars, and beyond
Human/Robotic Technology – Technologies to enable development of exploration space systems
Crew Exploration Vehicle – Transportation vehicle for human explorers
ISS Transport – US and foreign launch systems to support Space Station needs especially after Shuttle retirement



Schedule



- Currently, the Space Shuttle Program schedule is being driven by the time required to make the safety of flight changes
- Schedule is not a consideration in the classic Project Management sense
- The Mission driving objective is to fly before the International Space Station suffers a serious problem

WHEN IS THAT?


- Current safety milestones result in a Return to Flight date no earlier than March 6, 2005
- Our goal is to fly as soon as it is safe to do so to achieve oujr mission objectives



RTF Planning Focus OV-103/Discovery Critical Path Assessment





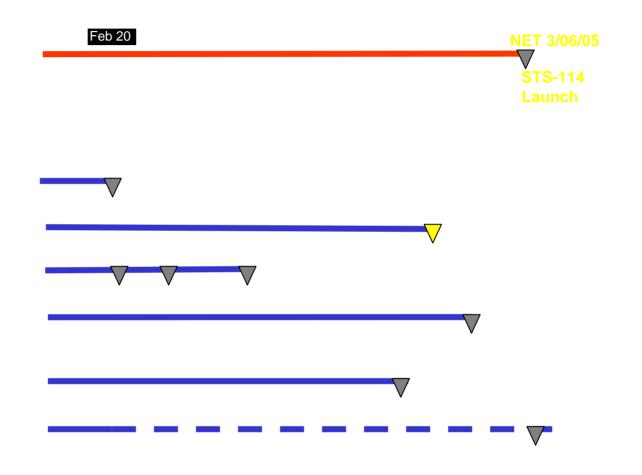

▼ Activity has Occurred

▼ Schedule in Jeopardy

Data Sources


- 1. USA Schedule Status 2/20/04
- 2. Feb 19 SFLC Meeting
- 3. Shuttle Program Reviews



FY 2005 Shuttle Mission Planning



- 3 missions to ISS
- STS-114 and STS-121 may have mission emphasis on demonstrating RTF capabilities
- February 19 Space
 Flight Leadership
 Council announced
 new target launch
 window of NET
 March 6 April 18,
 2005
- RTF remains
 milestone driver

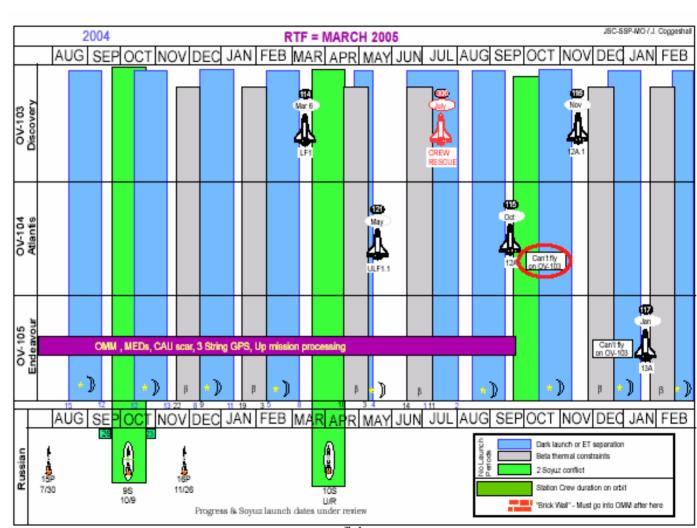



Management Challenges




- Culture change required
 - Space Shuttle is not an "operational" vehicle
 - It is experimental/research and development
 - Worker concerns are not to be dismissed by management
 - Additional engineering oversight of the process is required
- 13 Separate Independent Review Teams overseeing Space Shuttle Return to Flight
 - NASA Office of Inspector General has 17 audits of RTF in progress
- New Independent Technical Authority to oversee any "waivers" from standards
 - Over 5,6000 waivers in the Space Shuttle system today
 - No demarcation b between waivers to standards, safety, or other requirements



Origins of Standards and Requirements



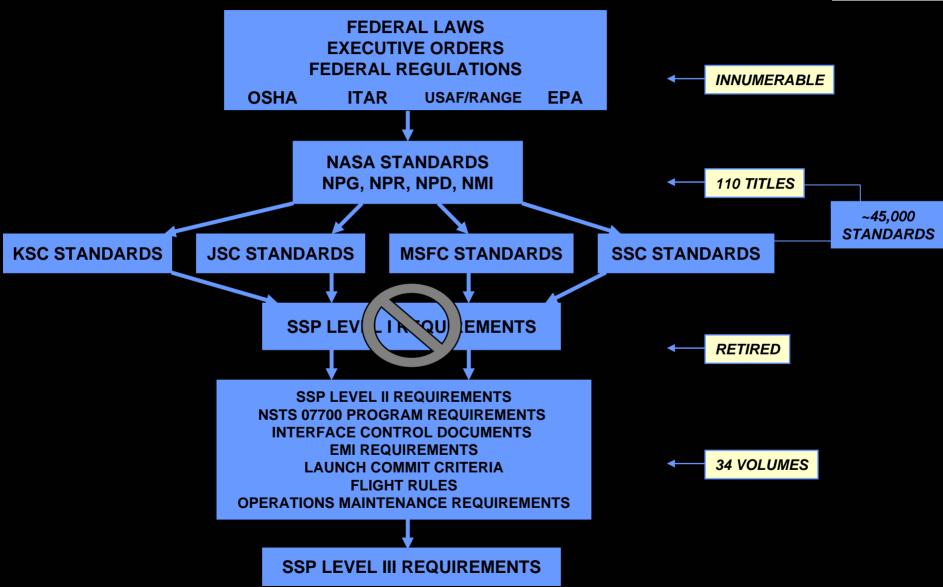



Why is it so hard?



Why is it so hard?

Why does it cost so much?

Compare space travel within aviation - compare the Space Shuttle to a Boeing 737







Comparison of the Space Shuttle to a Boeing 737




	122 feet	Length	138 feet
	78 feet	Wingspan	112 feet
	173,500 pounds	Empty (dry) weight	93,680 pounds
	April 12, 1981	First flight	B737-100 April 9, 1967 (-900 Nov 20, 1997)
(inclu	To low earth orbit: 56,000 lbs (including crew of 7 & provisions) SHUTTLE EXTERNAL TANK: DRY 66,000 LBS; LOADED 1,655,600 LBS SHUTTLE SRB (EACH): EMPTY 192,000 LBS; LOADED 1,292,000 LBS SHUTTLE SYSTEM DRY WEIGHT: 173,500+66,000 + 192,000 + 192,000 = 623,500 LBS ORBITER ONBOARD PROPELLANT LOAD (OMS + RCS): 23,876 + 7,256 = 31,091 LBS SHUTTLE SYSTEM PROP WT: 1,100,000 + 1,100,000 + 1,589,600 + 31,091 = 3,821,000 LBS		52,500 pounds Crew of 2 + 189 Passengers
DRY SHUTTLE SR EMPT SHUTTLE SY 173,5 ORBITER ON 23,87 SHUTTLE SY 1,100			6,875 US GAL = 55,000 pounds



Comparison of the Space Shuttle to a Boeing 737



- TOTAL SHUTTLE VEHICLE WEIGHT AT LIFTOFF: 4.5 MILLION LBS
- 85% IS PROPELLANT
- 14% IS VEHICLE STRUCTURE
- 1.3% IS PAYLOAD AND CREW
- PROPELLANT RESERVE AT MECO --- 2,300 LBS = 00.060
- B737 MAX TAKEOFF WEIGHT 174,200 LBS
- 31% IS FUEL
- 54% IS VEHICLE
- 30% IS PAYLOAD (passengers, crew, baggage
- FAA REQUIRED FUEL RESERVE: 45 MINUTES LOITER PLUS DIVERT

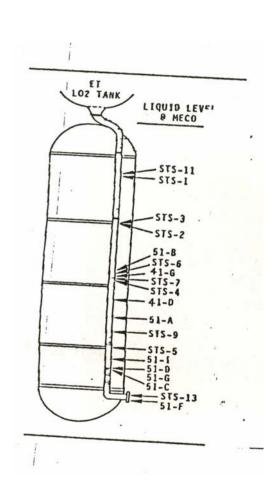



Comparison of the Space Shuttle to a Boeing 737



17,500 MPH (M=25 at 400,000 feet)	M 0.82		
Zero payload	41,000 feet		
600 N. Miles (3,600,000 feet)			
Average Trip Distance 4 Million miles (14 days)	3,158 statute miles (6 hours)		
6,750,000 pounds	2CFM56-7B26 engines 26,300 pounds		

Why so much difference?



Energy for Spacecraft vs Aircraft



Typical commercial airline cruise: 30,000 ft (5 N.MI.) at 500 MPH Orbital spacecraft minimum: 100 N. MI. at 17,500 MPH

 $E = PE + KE = m h gc + \frac{1}{2} m v^2$

Energy = Mass X Altitude X Gc + 1/2 Mass X Velocity Squared

FOR THE SAME MASS

Altitude difference: 20 times greater (5 miles vs 20 miles)

Potential energy difference: 20 times greater

• Velocity difference squared is (17,500)² / (500)²

• Kinetic energy difference: 1000 times greater

If it was easy, everyone would be doing it!



What About Re-Entry?



Commercial aircraft land with what they take off with Spacecraft, until the Space Shuttle, do not

97% of all orbital launches recover --- nothing

Soyuz can return 50 kg of scientific equipment and experimental results

Apollo could bring back 250 pounds of lunar rocks, film, experiments

Space Shuttle can return 30,000 pounds of payload, safely to the earth



What About Re-Entry?



The Law of Conservation of Energy

Everything that goes into putting the Space Shuttle into orbit

(4+ million pounds of high energy chemicals), must be removed during re-entry

Orbital velocity is approximately 25,600 FPS

Deorbit burn changes velocity by approximately 300 FPS

Main gear touchdown to wheel stop - brakes, drag chute, speed brakes - remove approximately 300 FPS

25,000 FPS = 98% of the velocity = 99.96% of the kinetic energy – removed by air friction alone

100% of the potential energy removal is accomplished by air friction



